

Hull Roughness Gauge

DC9000

Operating Instructions (V4.0 1123)



IMPORTANT! Before taking this instrument in use we strongly advise you to read this manual carefully.

CONTENT

1	General	5	7	Menu display information and operation	12
1.1	Importance of operating manual	5	7.1	Main menu	12
1.2	User-responsibility	5	7.2	Instrument setup	12
1.3	Responsibility of personnel	5	7.2.1	Setup time and Date	12
1.4	Dangers	5	7.2.2	Setup acoustics	13
1.5	Designated purpose	5	7.2.3	Setup display	13
1.6	Copyright	5	7.2.4	HRG - Adjustable Rt()	13
1.7	Manufacturer's/Supplier's address	5		(spring 2014 models only)	
			7.3	Memory	14
			7.3.1	Batch options	14
			7.4	Measure	15
			7.4.1	Accept series	16
			7.4.2	Assign measurement-series to hull sections	16
2	Safety Instructions	6	8	Calibration	17
2.1	Meaning of Symbols	6	8.1	Program ref. std. (Please read this chapter carefully.)	17
2.2	Availability of Safety Information	6	8.2	Calibrate gauge	17
2.3	Training of Personnel	6	8.3	Procedure	18
2.4	Dangers from Electrical Energy	6			
2.5	Points of Special Danger	7	9	Setting COM ports	19
2.6	Care, Maintenance, Repairs	7	9.1	COM ports 1,2,3 & 4	19
			9.2	COM ports 5 and above	19
			9.2.1	If COM port 1-4 are currently occupied	19
			9.2.2	If COM ports 1-4 are currently not occupied	20
3	Transport and Storage	7	10	HRG Windows application	21
3.1	Packing	7	10.1	Installation	21
3.2	User: Check on Receipt	7	10.2	Processing data with the HRG application	21
3.3	Reporting Transport Damage and Documentation	7			
3.4	Storage and Protective Measures when not in use	7	11	Care and Maintenance	22
			11.1	Inspection and Maintenance	22
			11.2	Disposal of Materials	22
			11.3	Customer Service	22
4	Instrument Data	8	12	Disclaimer	23
4.1	Name / Article	8			
4.2	Scope of Supply	8			
4.3	Technical Data	8			
4.4	Dimensions and Weight	8			
5	Instrument controls and functions	9			
6	Installation and preparations	10			
6.1	Batteries	10			
6.2	Connect your equipment	10			
6.3	Protect yourself and your equipment	11			
6.4	Switching on your gauge	11			

WARRANTY

Industrial Physics will grant a warranty for a period of 12 months for the TQC Sheen Hull Roughness Gauge and 12 months for all related equipment from the date of delivery in respect of any evidence of faulty workmanship and materials. Should a delivered consignment prove to be contrary to contract upon inspection, the customer shall grant Industrial Physics the opportunity hereunder of removing the fault, or else the customer may demand a replacement. Should the supply or delivery of any improvement or replacement not prove possible, the customer may choose between having the purchase price reduced or in demanding the contract of sale to be rescinded (conversion). Damage resulting from natural wear and tear, mechanical or chemical damage, an act of God or non-compliance with the operating instructions shall be excluded from the warranty as well as mechanical interference by the customer or by third parties with TQC Sheen Hull Roughness Gauge and related equipment without Industrial Physics' written permission. No liability will be accepted for defects, damage or injury caused due to use not carried out in accordance with the manufacturer's user instructions.

To claim warranty, the rejected product has to be sent to Industrial Physics together with the original invoice, any exchange before the product has been returned to Industrial Physics is not possible. Industrial Physics reserve the right to repair, exchange or supply an equivalent substitute. Industrial Physics is not liable for handling or transport costs. Warranty on the purchase price is limited, all liability for consequential damages or changes in technology is expelled.

1 GENERAL

1.1 Importance of operating manual

This manual is written in order to become familiar with all the functions and possible applications of the instrument. It contains important instructions about how to use the instrument safely and economically; according to the purpose designated. Following these instructions is not only essential to avoid risks. It also reduces repair costs and down-time and increases the products reliability and service-life.

Anyone who works with the instrument shall follow the instructions in this manual, particularly the safety related instructions. Additionally local rules and regulations relating to environmental safety and accident prevention should be observed. It is mandatory that users have read and understand this manual prior to first operation of the Automatic Film Applicator Compact.

1.2 User-responsibility

The user should

- a) Only allow persons to work with the instrument who are familiar with the general instructions on how to work safely and to prevent accidents. The use of the instrument should have been instructed duly. The safety chapter and the warnings in this manual should have been read and understood; acknowledged as evidenced by their signature.
- b) Regularly check the safety-awareness of personnel at work.

1.3 Responsibility of personnel

Before commencing work anyone appointed to work with the instrument should pay attention to the general regulations relating to working safety and accident prevention. The safety chapter and the warnings in this manual should have been read and understood; acknowledged as evidenced by their signature.

1.4 Dangers

This instrument has been designed and constructed in accordance with state-of-the-art technology and the acknowledged safety regulations.

Nevertheless, working with the instrument may cause danger to the life and health of the operator or to others, or damage to the instrument or other property. Therefore the instrument should only be used for its designated purpose, and in a perfect technical condition. Any defect that could have a negative effect on safety should be repaired and recorded.

1.5 Designated purpose

The TQC Sheen Hull Roughness Gauge is exclusively designed to apply thin films of liquid or pastes on test specimen. Other applications constitute improper use. TQC Sheen will not be held liable for damage resulting from improper use.

Designated purpose also includes properly observing all instructions in the operation manual, and adherence to perform roughness test on painted coated or blasted surfaces as described within the specifications. TQC Sheen is entitled to request these form when warranty claims are made and during inspections to ensure safe operation and evaluate correct usage.

1.6 Copyright

The copyright of this operating manual remains with TQC Sheen. This operating manual is intended solely for the user and his personnel. Its instructions and guidelines may not be duplicated, circulated or otherwise passed on to others, neither fully, nor partly. Infringement of these restrictions may lead to legal action may be taken if this restrictions are infringed upon.

1.7 Manufacturer's/Supplier's address

TQC Sheen | Industrial Physics
Molenbaan 19
2908 LL Capelle aan den IJssel
The Netherlands
T +31(0)10 7900 100

2 SAFETY INSTRUCTIONS

2.1 Meaning of Symbols

The following symbols for dangers are used in this instruction manual.



Possible immediate danger to the life or health of personnel.

Danger

If this guideline is not noted it can lead to severe danger to health, up to fatal injury.



A dangerous situation could be caused.

Warning

Non observance of this guideline can lead to injury or to damage to equipment.



Note Special tips and particular information.

Guidelines to make optimal use of the instrument.

2.2 Availability of Safety Information

The instruction manual should be kept in proximity to where the instrument operates and should be visible and accessible at any time of operation.

In addition to the information contained in the instruction manual, general and local regulations for accident prevention and environmental protection shall be kept available and observed. Always ensure all guidelines in respect of safety and dangers on the instrument are in readable condition.

In case of danger the instrument has to be switched off by means of the on / off switch at the left back side of the instrument or by unplugging the mains power, then the danger should be eliminated.

2.3 Dangers from Electrical Energy

- Work on the electrical supply may only be done by a qualified electrician.
- The electrical equipment of the instrument must be checked regularly.
Loose connections and cables must be corrected immediately.
- Always make sure the instrument's power is turned off while adjusting any electrical component.



Danger

Make sure that no paint or other liquids are spilled on the electronics

2.4 Modifications to the Equipment

- Any modifications or additions or alterations to the instrument may solely be made with permission from the manufacturer otherwise the warranty will be void.
- Instruments which are not in fault-free condition must immediately be switched off.
- Only use replacement parts from the original supplier. Parts used from other sources aren't guaranteed to take the loading and meet the safety requirements.

2.5 Points of Special Danger

There are some special points of danger:



Danger

Always use supplied neck-strap to free your hands while working on scaffolds or platforms

2.6 Care, Maintenance, Repairs

- Maintenance and inspection should be carried out at the correct intervals.
- Operating personnel should be informed before starting with maintenance or repair work
- Do not open the instrument. In case of malfunction always consult the manufacturer.

3 TRANSPORT AND STORAGE

3.1 Packaging

- Please take note of pictorial symbols on the packaging.

3.2 User: Check on Receipt

- Check Packaging for damage
- After unpacking check complete supply.

3.3 Reporting Transport Damage and Documentation

- Any damage should be documented as accurately as possible (possibly photographed) and reported to the relevant insurers or, in the case of sales “delivered to customers works”, to the supplier.

3.4 Storage and Protective Measures when not in use

- The instrument must be stored in a dry place at a temperature between 10 - 40°C.
- If packing is damaged upon receipt immediately inform the forwarder and make a note on the packing list and have it signed by the forwarder. Ideally make some pictures of the damage as well.
- Store instrument in the original packing if possible.

4 INSTRUMENT DATA

4.1 Name / Article

DC9000 TQC Sheen Hull Roughness Gauge.

4.2 Scope of Supply

- TQC Sheen Hull Roughness Control unit with neck-strap
- TQC Sheen Hull Roughness Sensor
- TQC Sheen Hull Roughness Sensor Cable
- DC9015 Calibration plate
- USB thumb drive with software
- USB connection cable for PC
- 4 x AA batteries

4.3 Technical Data

Memory capacity : 4000 series of measurements
Power Supply : Batteries, 4 x AA Batteries
Display : LCD 80mm, illuminated
Interface : Menu driven interface with 4-way directional push button

4.4 Dimensions and Weight

Sensor Depth : 205 mm
Sensor Width : 80 mm
Sensor Height : 40 mm
Sensor weight : approx. 630 g
Control unit Depth : 200 mm
Control unit Width : 115 mm
Control unit Height : 40 mm
Control unit weight : approx. 350 g

5 INSTRUMENT CONTROLS AND FUNCTIONS

- 1. Hull Roughness sensor
- 2. Sensor cable attachment
- 3. Soft rubber non-slip wheels
- 4. Status indication / warning lights
- 5. Neck-strap to securely carry your gauge
- 6. Hull Roughness Control unit
- 7. Hull Roughness Sensor cable
- 8. Illuminated LCD
- 9. 4-way directional push button
- 10. Indication LED for 'Measure'
- 11. Indication LED for 'Full series'
- 12. Indication warning LED for 'High Speed'
- 13. Hull Roughness Surface profile probe
- 14. DC9015 Calibration plate



6 INSTALLATION AND PREPARATIONS



Danger

Carefully unpack the apparatus and the accessories and check complete supply. Please assemble your equipment before climbing upon scaffolds or platforms. Use supplied neck-strap to securely attach the apparatus and prevent possible damage from falling.

6.1 Batteries

Your gauge runs on standard alkaline AA batteries. These batteries are easily available worldwide by local suppliers. The Hull Roughness gauge needs 4 AA batteries to operate.

Note Only use standard AA alkaline batteries to ensure proper functioning of your gauge. The use of rechargeable batteries is not recommended because they tend to suffer from too big voltage drops, possibly influencing measuring results.



Your gauge is supplied with a set of 4 AA batteries.

6.2 Connect your equipment

Connect the sensor and control unit with the supplied sensor cable. The direction of the cable is not important, both sides of the cable are identical male plugs and interchangeable. Firmly press the plugs in corresponding connectors on both the sensor and control unit. The plug is properly connected and locked into place when you hear / feel a click.



Note

To release the sensor cable from both sensor and control unit push the little button beside both connectors. The plug should be able to eject from the connector without the use of excessive force.

6.3 Protect yourself and your equipment

Please assemble your equipment before climbing upon scaffolds, cherry pickers or platforms. Use supplied neck-strap to securely attach the apparatus. Using the neck-strap is for your own safety and allows you to free one hand while it also prevents your gauge from falling.

6.4 Switching on your gauge

A single press on the 4-way directional push button will present you with the start-up screen. You are welcomed by our TQC Sheen logo and the current firmware version is displayed.

7 MENU DISPLAY INFORMATION AND OPERATION


7.1 Main menu

The TQC Sheen Hull Roughness Gauge has an advanced menu structure. The Main Menu allows the user to access all the features available. Use arrow buttons to navigate through menu options and press 'Ok' to confirm your choice.



7.2 Instrument setup

The setup menu allows you to calibrate your gauge. The calibrate procedure is explained in chapter 8 on page 17 of this manual. The other options need to be set once before first time use of your gauge.

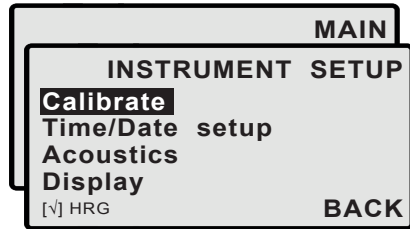


7.2.1 Setup time and Date

To the correct time in your gauge. (24 hour format).

Use the 4-way directional push button to select the digit you would like to change. Confirm your selection with a single press on the 'Ok' button. Use up and down buttons till the desired digit is displayed. Confirm your selection with a single press on the 'Ok' button and Continue with the next digit.

Set the correct date in your gauge. (DD/MM/YYYY format)

Use the 4-way directional push button to select the digit you would like to change. Confirm your selection with a single press on the 'Ok' button. Use up and down buttons till the desired digit is displayed. Confirm your selection with a single press on the 'Ok' button and Continue with the next digit.

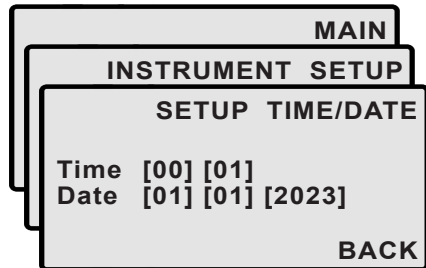

Note Your time and date settings are AutoSaved.

7.2.2 Setup acoustics

The sound level can be adjusted to your needs. Set the gauge to either: Signals off / Low volume and High volume.

Use up- and down buttons to select the desired acoustics level and confirm with a single press on the 'Ok' button.

Note Your acoustics settings are AutoSaved.

7.2.3 Setup display

To change both the backlight and contrast settings.

Use up- and down buttons to select either 'Backlight' or 'Contrast' and confirm with a single press on the 'Ok' button

Use left- and right buttons to adjust the 'Backlight' or 'Contrast' level. Confirm with a single press on the 'Ok' button.



Note Your display settings are AutoSaved.

7.2.4 HRG - Adjustable Rt() (spring 2014 models only)

Use left- and right buttons to change set Rt(value), default value is 50. Values can be set 1-99.

Using other Rt(values) deviates from the common consensus in respect to Rt(50) for Hull Roughness Surveys.

Note Your Rt(value) settings are AutoSaved.

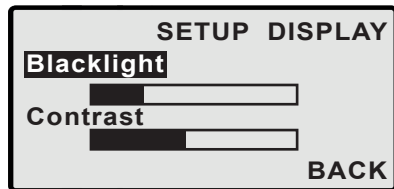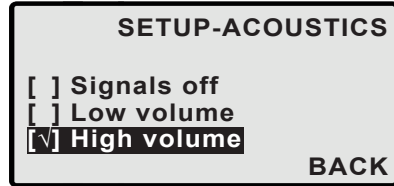


7.3 Memory

Measurements can be stored in different batches. The Hull Roughness Gauge can store up to 8 batches that can be named individually.

Click the 'Ok' button once to select a batch. A checkmark will appear before the selected batch.

Click the 'Ok' button once more in order to access the batch options.

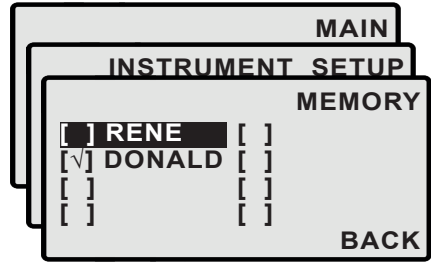

7.3.1 Batch options

Allows you to either name/rename batches, delete batches and send batches to a personal computer for further data analysis.

7.3.1.1 Renaming batches

Click 'Rename' to give the batch a name. Use the 4-way directional push button to select the character you would like to change. Confirm your selection with a single press on the 'Ok' button. Use up- and down buttons till the desired character is displayed. Confirm your selection with a single press on 'Ok' button and Continue with the next character.

Note Your batch names are AutoSaved.





7.3.1.2 Clear

Clear allows you to erase all measurements of the selected batch. A single press on the 'Ok' button will prompt you with a confirmation screen. Confirm the clearing of all batch data with a single press on the 'Ok' button.



Your data is permanently erased!

Note Depending on the amount of data, deleting data can take up to a minute. Please wait for the progress bar to fully complete the process.

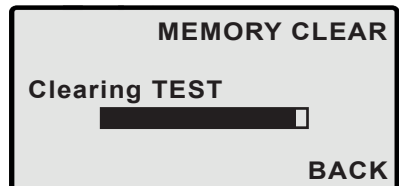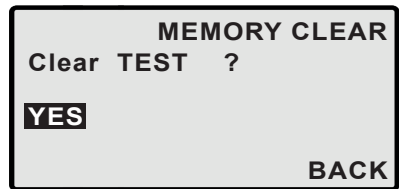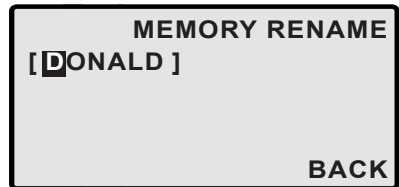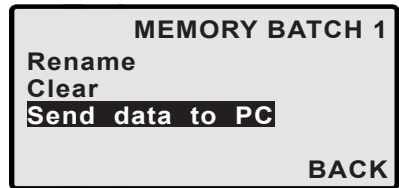

7.3.1.3 Send data to PC

In order to process your measured data it is essential to send your data to a Microsoft Windows PC with Microsoft Excel installed. Before sending the data following precautionary measures need to be taken:

1. Connect your gauge to the PC
2. Open the HRG application
3. Select the proper COM port
4. Click 'Open port'
5. When a connection is established you can confirm to Send your batch data by a single press on 'Ok' button.
6. Your raw data appears in the HRG application
7. Press 'Data -> Excel'

Note More information on setting COM ports is available in chapter 9 on page 19.

7.4 Measure





Once a batch is selected to store your measurements it is time to start your first measurements. Press start to advance.

In the following screen you can see your selected batch name. 'Series' indicates the taken runs of measurements.

Role the Hull Roughness sensor over the hull's surface, firmly pressing the sensor to the surface. One full run is taken over a length of approximately 90cm.

Keep moving the sensor unit over the surface until the indication LED 'Full series' starts to blink. A full run will also be indicated by a beep if acoustics are enabled.

Note To enable acoustics see chapter 7.2.2.

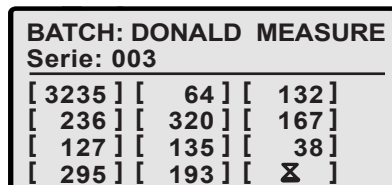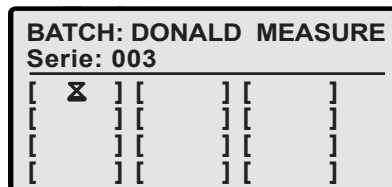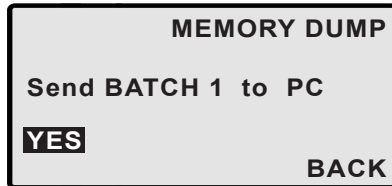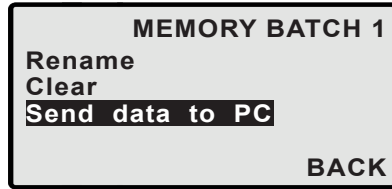

7.4.1 Accept series

After each measurement the Mean Hull Roughness (MHR) of the last series and the Average Hull Roughness (AHR) of all series is displayed.

If there are measurement errors or a need to measure the last Hull section once again, simply press 'Back' and redo the measurement. When satisfied, click 'Accept'. In the next step the series of measurements will be applied to the proper hull section.

7.4.2 Assign measurement-series to hull sections

After accepting the measurement results each series of measurements can be assigned to a specific hull section.

Either a starboard or portside image of the ship is displayed. Use the 4-way directional push button to select the corresponding hull section and click 'Ok' to assign your series to this hull section.



To switch between starboard and portside images select:

'SB < - > PS' (Starboard vs. Portside)

Press 'Ok' button to switch the displayed image.

Already measured sections are indicated with a small square.

Once a hull section has been measured you could overwrite the section data. Select the square marked section and click the 'Ok' button once to overwrite older measurements.

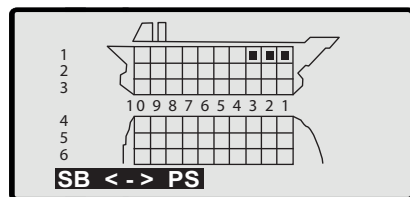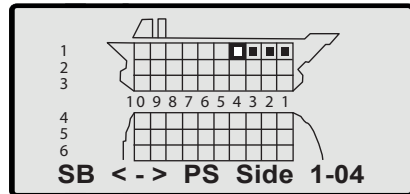

Overwrites are permanent, you are not asked or warned with a confirmation screen.

8 CALIBRATION

To ensure proper measurements it is required to regularly calibrate your gauge.

Note For best calibration results allow your equipment to adjust to ambient temperature for about ten minutes.

8.1 Checking the reference points

The calibration certificate for the supplied calibration plate states the actual reference points values on the calibration plate. These values are entered in the device upon calibration in our facilities. They should correspond to the values on the certificate.




Example:

The 500 µm reference point is actually 498 µm. In the 'program ref. std.' option you can check and Imageadjust the gauge according to the actual values..

Select:

1. Instrument setup
 2. Calibrate
 3. Program ref. std.
- Using Up- and Down buttons select [0500] and click 'OK'. ([0500] starts to blink)
 - Use Up/Down button to adjust the value to the value stated in your calibration certificate, 498 µm in our example and press 'OK'.
 - Use the Down button to select the next values. Finally use the Right button to select CONFIRM and click OK your adjustments to save the made alterations.

Note After a new calibratio of the gauge notice that the 'Ref.' values have changed according to your the made adjustments.

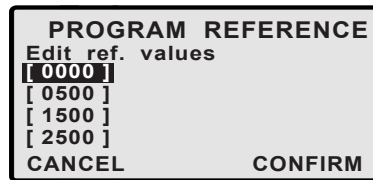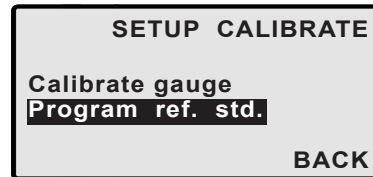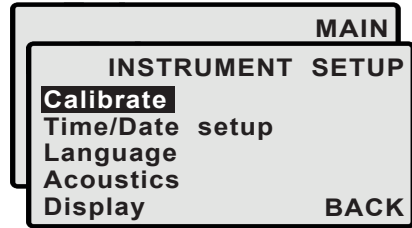

8.2 Calibrate gauge

Select from menu:

1. Instrument setup
2. Calibrate
3. Calibrate gauge

Position the sensor unit as displayed in the image below:



8.3 Procedure

Please note that the calibration plate has 3 reference points: 500 μm , 1500 μm and 2500 μm . The actual depths of reference points are entered in the device upon the first calibration in our facility. See 1.3.

(Move the sensor unit back and forth to assure proper alignment with the calibration plate.)

-
4. Click 'Ok' to start the calibration procedure
 5. Align the rear wheel with the '**0 μm** ' on the calibration plate. **Press 'Ok'.**
 6. Align the rear wheel with the '**500 μm** ' on the calibration plate. **Press 'Ok'.**
 7. Align the rear wheel with the '**1500 μm** ' on the calibration plate. **Press 'Ok'.**
 8. Align the rear wheel with the '**2500 μm** ' on the calibration plate. **Press 'Ok'.**
 9. Confirm your new calibration by pressing 'Synchronize'.

9 SETTING COM PORTS

The computer system will automatically assign a COM port number to the gauge. Please check Windows 'Device Manager' to learn the assigned COM port.

Unfold 'Ports (COM & LPT)'. The gauge is recognized as:

'USB Serial Port (COM...).'

If Windows failed to recognize the Hull Roughness Gauge and it's not visible in Windows Device Manager disconnect and reconnect the gauge and pay close attention to the list in Windows Device Manager as the gauge should reappear.

9.1 COM ports 1,2,3 & 4

Please set HRG software COM port settings to the assigned COM port. Currently only 4 COM ports are supported..

If the gauge is recognized as COM 5 or higher please contact the IT department for a workaround or continue reading next chapter '9.2 COM ports 5 and above'.


9.2 COM ports 5 and above


The gauge has an assigned COM port number of 5 or higher since 1-4 are in use or have been in use by other computer devices in the past.

9.2.1 If COM port 1-4 are currently occupied

Move one of the devices connected to COM ports 1,2,3 or 4 to port number 5 or above:

- Select view and show hidden devices
- Select the device to move in 'Device Manager' and right click the mouse.
- Subsequently select Properties / Port settings tab / Advanced
- Edit current port number and confirm any changes made.

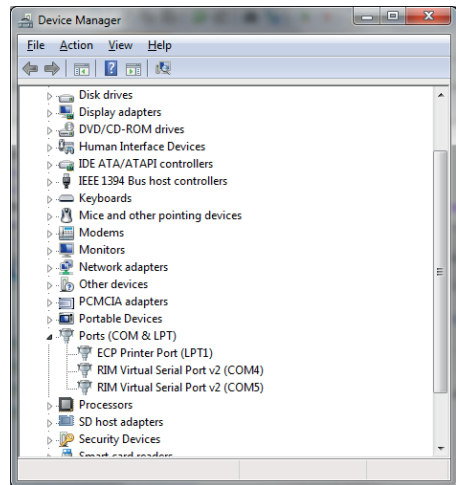

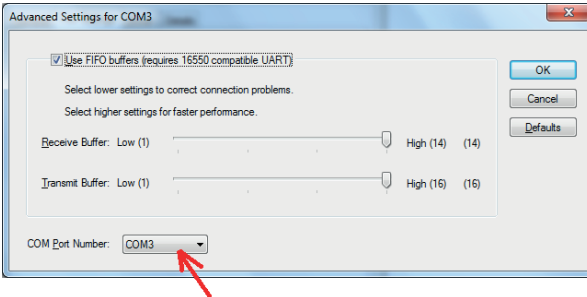

Set current COM (1-4) to 5 or higher.

Subsequently repeat previous steps to move the gauge to either COM ports 1,2,3 or 4.

9.2.2 If COM ports 1-4 are currently not occupied

If COM ports 1-4 are currently not in use but the Hull Roughness Gauge has an assigned COM port number of 5 or higher:

- Select the Hull Roughness Gauge in 'Device Manager' and right click your mouse.
- Subsequently select Properties / Port settings tab / Advanced
- Move your gauge to either COM ports 1,2,3 or 4 and confirm any changes made.

10 HRG WINDOWS APPLICATION

10.1 Installation

The HRG application supplied on the USB thumb drive does not require any installation. Double click the HRG V1.01 file to launch the application.



Your Windows installation might prompt you with a “The publisher could not be verified” message. Please click ‘Run’ to continue.



10.2 Processing data with the HRG application

This application functions as an interface between your Hull Roughness Gauge and the Microsoft Excel Survey Report.

- Please select the proper COM port (chapter 10 of this manual) and click ‘Open Port’.
- Use your gauge to select a batch and send it to the HRG application (chapter 8.3.2.2)
- Click ‘Data -> Excel’ to generate your Hull Roughness Survey Report.



11 CARE AND MAINTENANCE

11.1 Inspection and Maintenance

- Though robust in design, this instrument is precision-machined. Never drop it.
- Always clean the instrument after use.
- Clean the instrument using a soft dry cloth. Never clean the instrument by any mechanical means such as a wire brush / abrasive paper. This may cause, just like aggressive cleaning agents, permanent damage.
- Do not use compressed air to clean the instrument.
- Generally the TQC Sheen Hull Roughness Gauge does not require any maintenance.



Warning

Make sure that no paint or other liquids are spilled on the electronics or left in the holes.

11.2 Disposal of Materials

Disposal of materials used in the operation of the instrument or for auxiliary functions and exchanged items should be dealt with safely and in a manner that will not harm the environment. Follow the local regulations.

11.3 Customer Service

Customer service is provided on request by:

Industrial Physics
Molenbaan 19
2908 LL Capelle aan den IJssel
The Netherlands

<https://industrialphysics.com/support/>

12 DISCLAIMER

The right of technical modifications is reserved.

The information given in this manual is not intended to be exhaustive and any person using the product for any purpose other than that specifically recommended in this manual without first obtaining written confirmation from us as to the suitability of the product for the intended purpose does so at his own risk. Whilst we endeavour to ensure that all advice we give about the product (whether in this manual or otherwise) is correct we have no control over either the quality or condition of the product or the many factors affecting the use and application of the product. Therefore, unless we specifically agree in writing to do so, we do not accept any liability whatsoever or howsoever arising for the performance of the product or for any loss or damage (other than death or personal injury resulting from our negligence) arising out of the use of the product. The information contained in this manual is liable to modification from time to time in the light of experience and our policy of continuous product development.



www.industrialphysics.com